



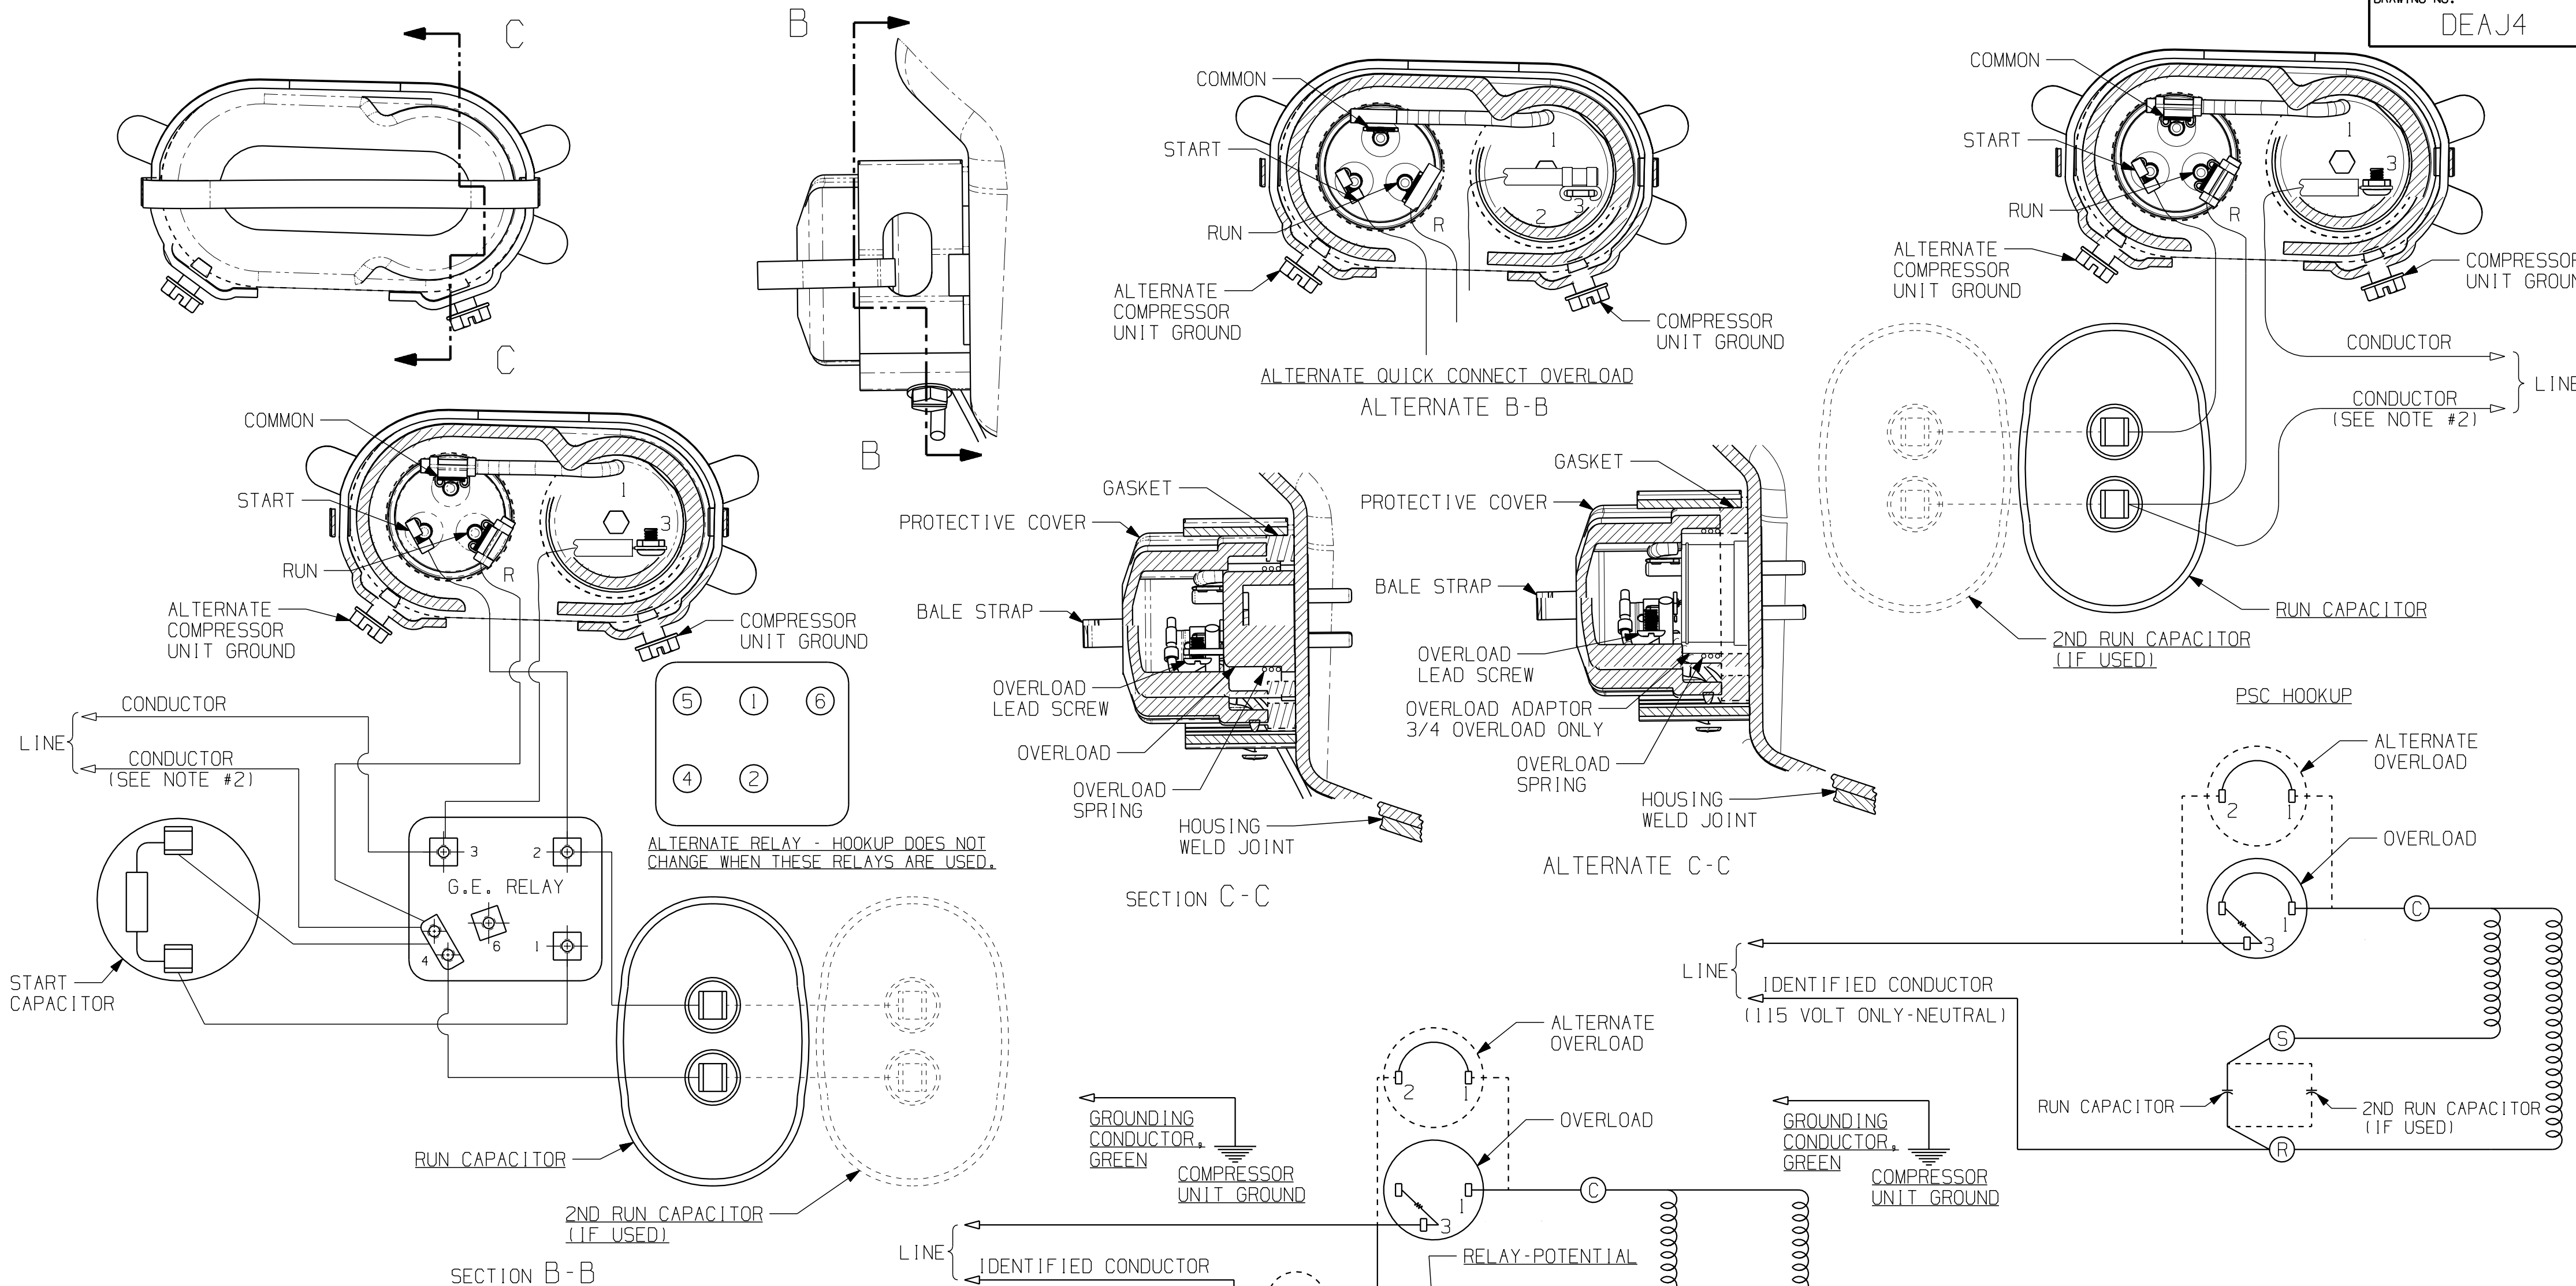

WARNING- WIRING DIAGRAM MUST BE FOLLOWED AS SHOWN. ANY MISWIRING CAN CAUSE SERIOUS ELECTRICAL HAZARD AND POTENTIAL DAMAGE OR RUPTURE OF COMPONENT ELECTRICAL PARTS.

- NOTES:
1. ASSEMBLE THESE PARTS AS SHOWN IF SPECIFIED ON B/M.
 2. IDENTIFIED CONDUCTOR MAYBE WHITE OR RIBBED (115 VOLT ONLY-NEUTRAL).
 3. IF TWO RUN CAPACITOR ARE REQUIRED HOOKUP AS SHOWN.
 4. COMPRESSOR UNIT GROUND SCREW IS NOT PROVIDED BY T.P.CO.

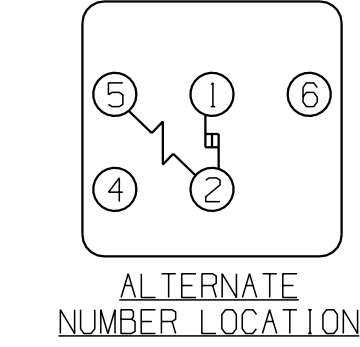

115 OR 230 V.-SCHEMATIC WIRING DIAGRAM - CSR OR CSR START CAPACITOR ASSIST (REF. DWG. MD472-35)

115 OR 230 V.-SCHEMATIC WIRING DIAGRAM - PSC (REF. DWG. MD472-4)

AJ - 115 OR 230 VOLT - PSC
AJ - 115 OR 230 VOLT - CSR OR CSR START CAPACITOR ASSIST AJ

ENGLISH	
	☆ = CATEGORY I
	△ = CATEGORY II
	□ = CATEGORY III
	○ = CATEGORY IV

DRAWING NO. DEAJ4		ELECTRICAL HOOKUP		SCALE 1:1 & NOTED		THIS PRINT SUPERSEDES ALL PRINTS PRIOR TO	
T.E.C.U.M.S.E.H. PRODUCTS CO. T.E.C.U.M.S.E.H., MICHIGAN		MATERIAL NOTED		DRAWING No. M0888-08		REVISION LEVEL: REL	
#244142-000 REDRAWN, & REVISED ORIENTATION OF LEAD WIRE.		DATE CHANGE		115 OR 230 V.-SCHEMATIC WIRING DIAGRAM - CSR OR CSR START CAPACITOR ASSIST		DRAWING NO. DEAJ4	
7F 3F		U		115 OR 230 V.-SCHEMATIC WIRING DIAGRAM - PSC		DRAWING NO. DEAJ4	